

WAAS CH 72608 W12A	APP CRS 121°	Rwy Idg 8501 TDZE 62 Apt Elev 73
--	------------------------	---

RNAV (GPS) RWY 12
KING SALMON (AKN)(PAKN)

RNP APCH-GPS.


Y For uncompensated Baro-VNAV systems, procedure NA below -18°C or above 54°C.
A For non ALS, increase LPV Cat E visibility to RVR 4000, increase LNAV/VNAV all Cats visibility to RVR 5000 and increase LNAV Cat E visibility to 1/2 SM. When control tower closed, LPV, LNAV/VNAV and LNAV visibility RVR 5000. When control tower closed, inoperative table does not apply to LPV, LNAV/VNAV and LNAV Cats A/B.
 #RVR 1800 authorized with use of FD or AP or HUD to DA (NA when control tower closed).

SSALR



MISSED APPROACH:
Climb to 3000 direct
FELUM and on track
211° to JUTAN and
on track 272° to
OLLER and hold.

ATIS 128.8	ANCHORAGE CENTER 124.8 354.0	KING SALMON TOWER* 118.3 279.5	GND CON 121.9	UNICOM 122.95	CTAF 121.9 352.05
---------------	---------------------------------	-----------------------------------	------------------	------------------	----------------------

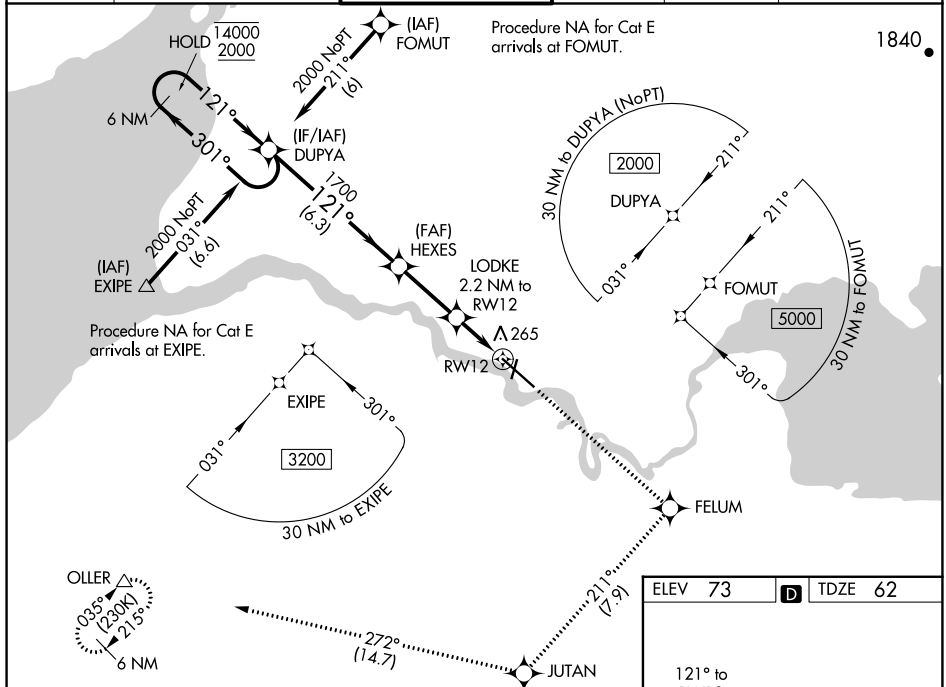

VGSI and RNAV glidepath not coincident
(VGSI Angle 3.00/TCH 66).

CATEGORY	A	B	C	D	E
LPV DA#	262/24 200 (200-½)				
RNAV/VNAV DA	426/35 364 (400-⅝)				
RNAV MDA	520/24 458 (500-½)		520/45 458 (500-⅞)		
C CIRCLING	580-1 507 (600-1)		580-1½ 900-2¾ 507 (600-1½) 827 (900-2¾)		960-3 887 (900-3)

MIRL Rwy 18-36 **L**
HIRL Rwy 12-30 **L**

