

BEND, OREGON

AL-5579 (FAA)

23334

VORTAC DSD 117.6 Chan 123	APP CRS 136°	Rwy Idg 5201 TDZE 3432 Apt Elev 3459
---	------------------------	---

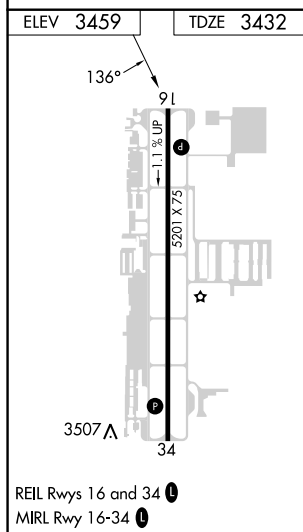
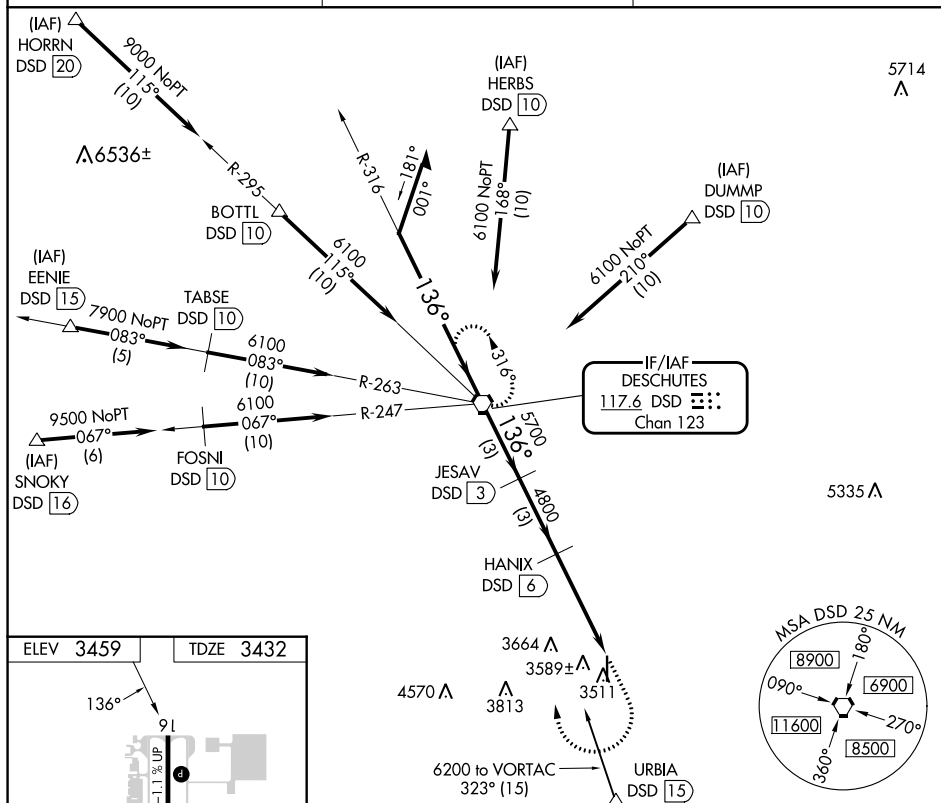
VOR RWY 16
BEND MUNI (BDN)

DME required.

T Rwy 16 helicopter visibility reduction below $\frac{3}{4}$ SM NA. When local altimeter setting not received, use Redmond altimeter setting and increase all MDAs 100 feet and increase S-16 visibility Cats C and D $\frac{1}{4}$ SM, and Circling visibility Cat C $\frac{1}{2}$ SM.

MISSED APPROACH: Climb to 4700 then climbing right turn to 7000 direct DSD VORTAC and hold, continue climb-in-hold to 7000.

AWOS-3 134.425	SEATTLE CENTER 126.15 269.475	UNICOM 123.0 (CTAF) 0
--------------------------	---	---------------------------------

[illegible]

BEND, OREGON
Amdt 11 10AUG23

44°06'N-121°12'W

BEND MUNI (BDN)
VOR RWY 16

NW-1, 22 FEB 2024 to 21 MAR 2024