


WAAS CH 63142 W16A	APP CRS 161°	Rwy Idg TDZE Apt Elev	6400 9934 9934
--	------------------------	-----------------------------	---

RNAV (GPS) RWY 16


LAKE COUNTY (LXV)

RNP APCH-GPS.	MISSED APPROACH: Climb to 16000 direct MORYU and on track 142° to LOZUL and hold, continue climb-in-hold to 16000. #Missed approach requires minimum climb of 240 feet per NM to 12500.
Baro-VNAV NA. When local altimeter setting not received, procedure NA.	

ASOS 118.375	DENVER CENTER 119.85 363.15	UNICOM 122.8 (CTAF) 0
------------------------	---------------------------------------	---------------------------------

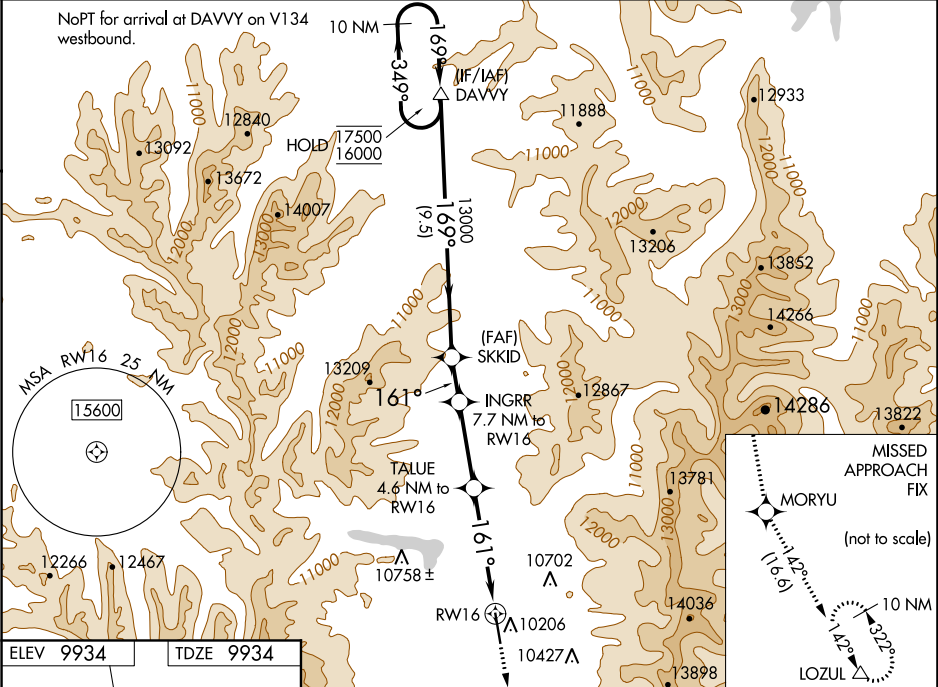

ELEV 9934	TDZE 9934
-----------	-----------

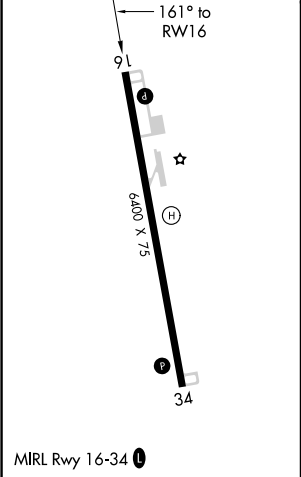

VGSi and RNAV glidepath not coincident (VGSi Angle 3.00/TCH 45).				
10 NM Holding Pattern DAVVY				
17500 ← 349° → 169° → 169° → 13000 → 161° → 12460 → 11440 → 2.4 NM to RW16				
GP 3.04° TCH 51				
9.5 NM 1.6 NM 3.1 NM 2.2 NM 2.4 NM				
CATEGORY	A	B	C	D
LPV DA#	10184-1	250 (300-1)		NA
LPV DA	10546-1¾	612 (700-1¾)		NA
LNAV/VNAV DA	10542-1¾	608 (700-1¾)		NA
LNAV MDA	10740-1 806 (900-1)	10740-1¼ 806 (900-1¼)	10740-2½ 806 (900-2½)	NA
CIRCLING	10740-1 806 (900-1)	11040-1½ 1106 (1200-1½)	12020-3 2086 (2100-3)	NA