


LOC I-MSS	APP CRS	Rwy Idg	5601
108.7	045°	TDZE	205
		Apt Elev	221

ILS or LOC RWY 5
MASSENA INTL-RICHARDS FLD (MSS)

ADF required. ADF and RADAR required for procedure entry.		MISSED APPROACH: Climb to 1200 then climbing left turn to 2300 direct MISSE LOM and hold.
▼	Circling Rwy 9, 23, 27 NA at night. When local altimeter setting not received, use Potsdam altimeter setting and increase DA to 528 feet and all visibilities ¼ SM; increase all MDAs 80 feet, visibility Cat C and D ½ SM and Circling visibility Cat C and Cat D ¼ SM.	
▲ NA		

ASOS 128.075	BOSTON CENTER 135.25 377.1	UNICOM 123.0 (CTAF) 0
-----------------	-------------------------------	--------------------------

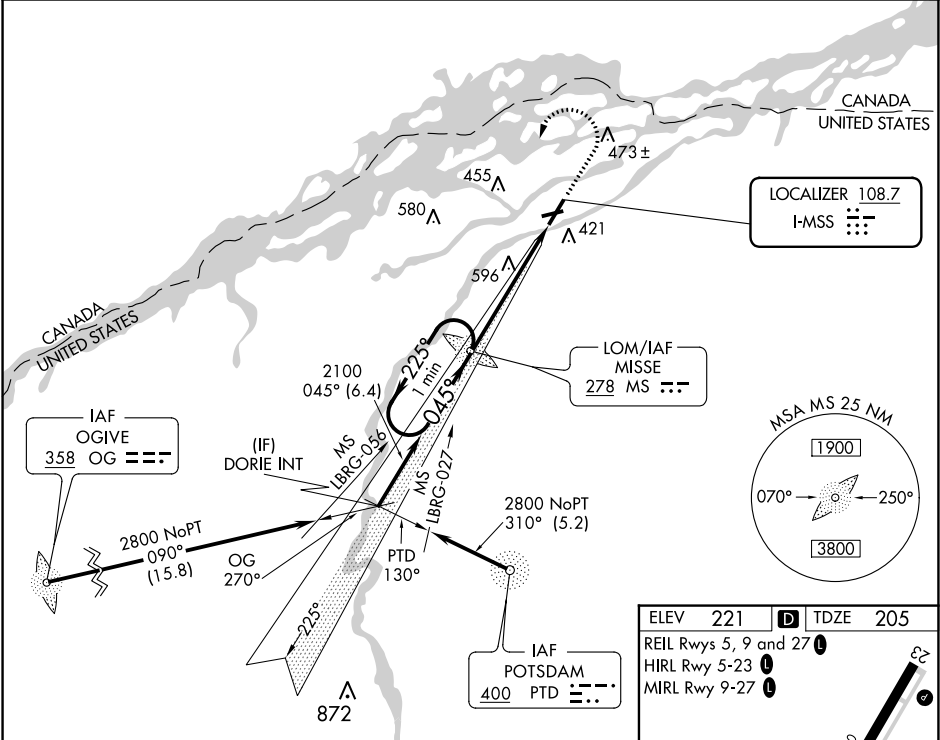

One Minute Holding Pattern		MISSE LOM	1200	2300	MS
2300		1994	VGSI and ILS glideslope not coincident (VGSI Angle 3.00/TCH 58).		
225°		045°	5.4 NM		
GS 3.00°		2100			
TCH 54					
CATEGORY	A	B	C	D	
S-ILS 5		455-¾	250 (300-¾)		
S-LOC 5	800-1	595 (600-1)	800-1¾	595 (600-1¾)	
CIRCLING	800-1	579 (600-1)	880-1¾	900-2¼	
			659 (700-1¾)	679 (700-2¼)	

ELEV	221	
------	-----	--