

APP CRS
078°

Rwy Idg
TDZE
944

11200
944
944

RNAV (RNP) Z RWY 8L
ONTARIO INTL (ONT)

▼


▲ NA

For uncompensated Baro-VNAV systems, procedure NA below 2°C (36°F) or above 54°C (130°F).

MALSR

MISSED APPROACH: Climb to 5300 direct CABUB on track 161° to DLIUS and hold, continue climb-in-hold to 5300.

D-ATIS 124.25	SOCAL APP CON 127.0 318.2	ONTARIO TOWER 120.6 360.775	GND CON 121.9 257.8	CLNC DEL 118.1	CPDLC
-------------------------	-------------------------------------	---------------------------------------	-------------------------------	--------------------------	-------

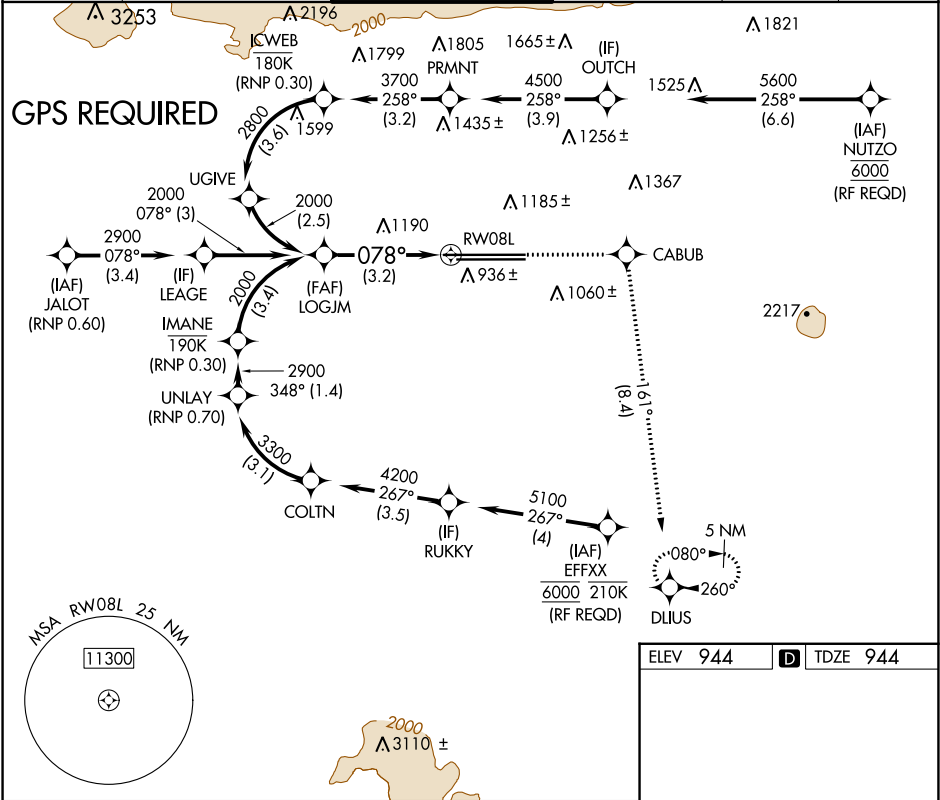

VGSI and RNAV glidepath not coincident (VGSI Angle 3.00/TCH 62).

5300

CABUB

tr 161°

DLIUS

LOGJM

2000

2000

078°

RW08L

GP 3.00° TCH 45

See planview for multiple IF locations.

3.2 NM

CATEGORY	A	B	C	D
RNP 0.30 DA	1490-13 ⁵ / ₈ 546 (600-1 ⁵ / ₈)			

AUTHORIZATION REQUIRED

ELEV 944

D TDZE 944

TDZ/CL Rwy's 8L, 26R and 26L
HIRL Rwy's 8L-26R and 8R-26L