

LOC I-STX <u>109.5</u>	APP CRS 097°	Rwy Idg 9003 TDZE 74 Apt Elev 74
----------------------------------	------------------------	---

ILS or LOC RWY 10
HENRY E ROHLSEN (STX)(TISX)


T Circling NA N of Rwy 10-28. If local altimeter setting not received, procedure NA. For inoperative MALSR, increase S-ILS 10 all Cats visibility to 1.




MISSED APPROACH: Climb to 700 then climbing left turn to 2400 direct COY VOR/DME and hold, continue climb-in-hold to 2400.

ATIS 135.65	SAN JUAN CENTER 128.65 279.6	ST. CROIX TOWER ★ 118.6 (CTAF) 0 239.3	GND CON 121.7	UNICOM 123.0
-----------------------	--	--	-------------------------	------------------------

ADF REQUIRED

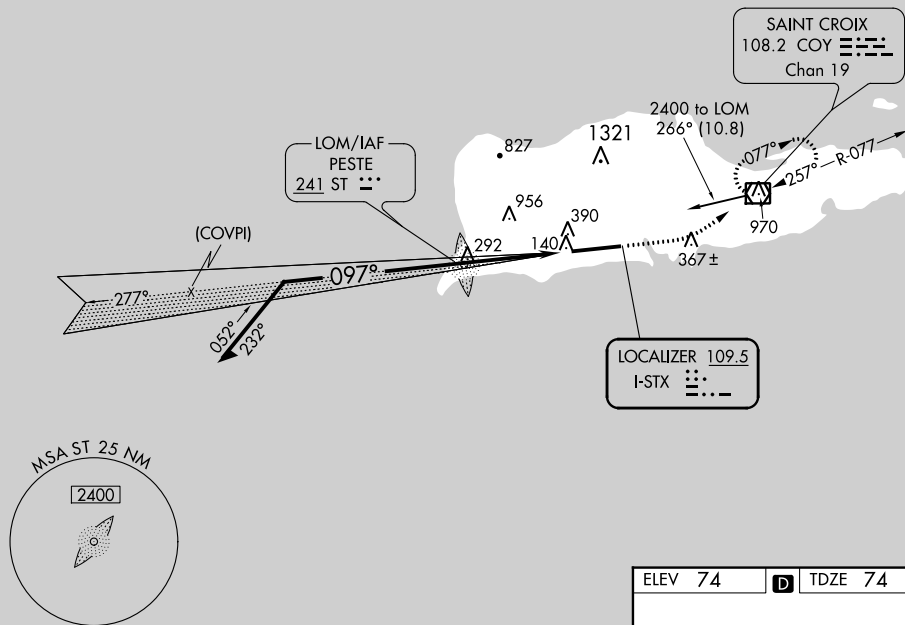

VGSI and ILS glidepath not coincident
(VGSI Angle 3.00/TCH 73).

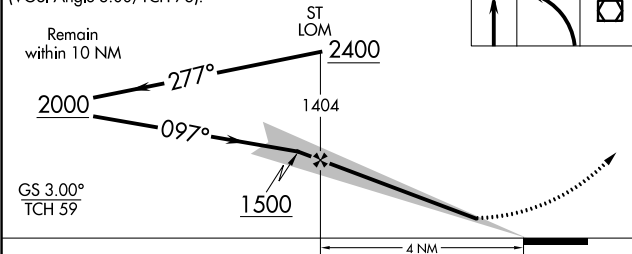

CATEGORY	A	B	C	D
S-ILS 10	375- $\frac{1}{2}$ 301 (400- $\frac{1}{2}$)			
S-LOC 10	480- $\frac{1}{2}$ 406 (500- $\frac{1}{2}$)		480- $\frac{3}{4}$ 406 (500- $\frac{3}{4}$)	
CIRCLING	520-1 446 (500-1)	600-1 526 (600-1)	720- $\frac{13}{4}$ 646 (700- $\frac{13}{4}$)	720-2 646 (700-2)

